




1020 S.Sangamon Ave. Gibson City, IL 60936

Ph# (217) 784-4261

Fax# (217) 784-1093

# INFORMATION BULLETIN

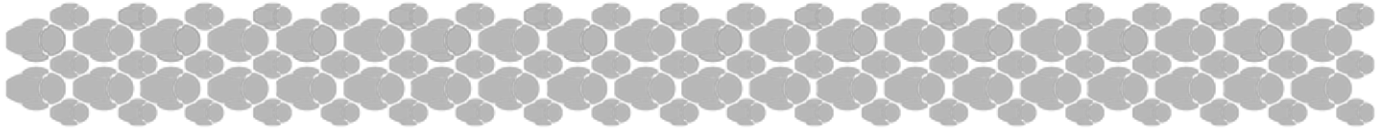

**Products affected:** TS12

**Complaint:** Main driveline disengages from tractor PTO output shaft. Main driveline becomes bent at the profile overlap.

**Cause:** Main driveline profile is galling from lack of lubrication.

**Correction:** Lubricate profile at specified interval indicated in owner's manual. May be necessary to unhook driveline from tractor and telescope the profile "out" to expose lube fitting.

**Reference Part:** 00790233 Main Driveline

**Labor hours:** Information only; No labor